

SB, Protective washer for carrier bearing seal, 545 Mark II, 550 XP/XPG Mark II, 2020-06

Affected models

Model	PNC	Serial Range	
		Start	End
550 XP/XPG Mark II	All	20184800001	20201700001
545 Mark II	All	20184800001	20201700261

Affected markets

All.

Description

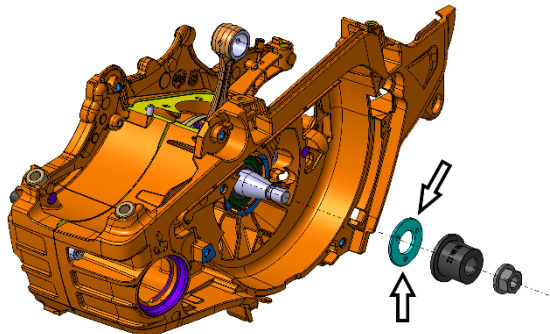
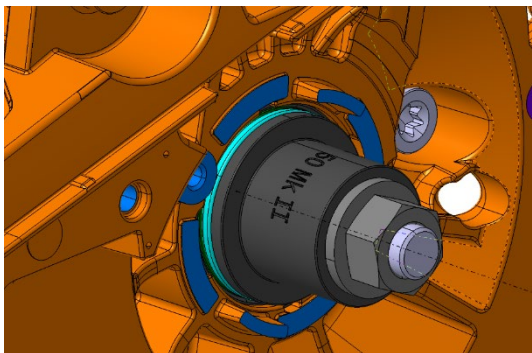
To increase durability and prevent leakage from the ball bearing sealing, a protective washer has been added on the flywheel side. There is full interchangeability.

The protective washer is mounted outside of the main bearing with the installation tool. It is important to use a torque wrench and apply 2 Nm force when assembling the washer. This is described in the Workshop Manual.

The protective washer was introduced in production from serial number:

550 XP/XPG Mark II: 20201700001

545 Mark II: 20201700261

	
Protective washer 596 91 13-01	Installation tool 596 99 03-02
	Flywheel Nut 503 22 04-01

Revision History

Rev.	Date	Order id.	Description
A	2020-06	SB-5747	Created